Check PRTs of molbloc

• Check the resistance of the two PRTs inside the molbloc



Pin	Description
-----	-------------


- 6 PRT1-
- 7 PRT2+
- 14 PRT2-

Ohms	Nominal Temperature
100 Ohm:	0.00°C / 32F
107 Ohm:	18°C / 64F
110 Ohm:	25.67°C / 78.2F
115 m: 38.50°C / 101.3F	

• To check at the circuit board and inspect PRT solder connections, the molbloc cover needs to be removed. Remove both screws and the plastic cap.



• T1 is on blue side of molbloc. T2 is on red side.

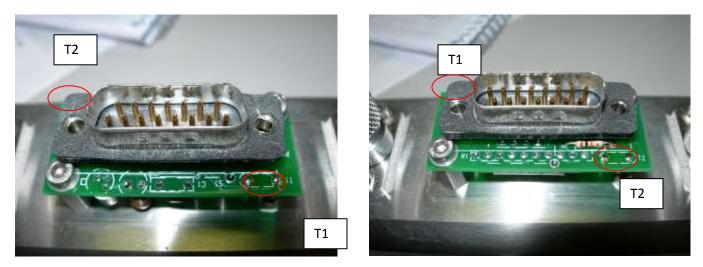

• This is very rarely an issue but the solder should ideally have a profile as shown in "B" below rather than "A".

